

Terminal Block Wiring Gate

August 20, 2012

Issue Severity:	Product Affected:
<input type="checkbox"/> High: Act immediately	<ul style="list-style-type: none">• B820• ENKIT-SDI2
<input type="checkbox"/> Medium: Recommended action(s) described below.	
<input checked="" type="checkbox"/> Low: Advisory	


1.0 Issue

Incorrect insertion of the wire below the gate of the terminal block can cause a short on the board, overheating, and component failure. Based upon control panel programming, the device is reported as missing by the control panel.

2.0 Resolution

Immediate Resolution

Verify the wiring is inserted correctly into the terminal block gate to avoid the issue. Refer to *Figure 1* below.

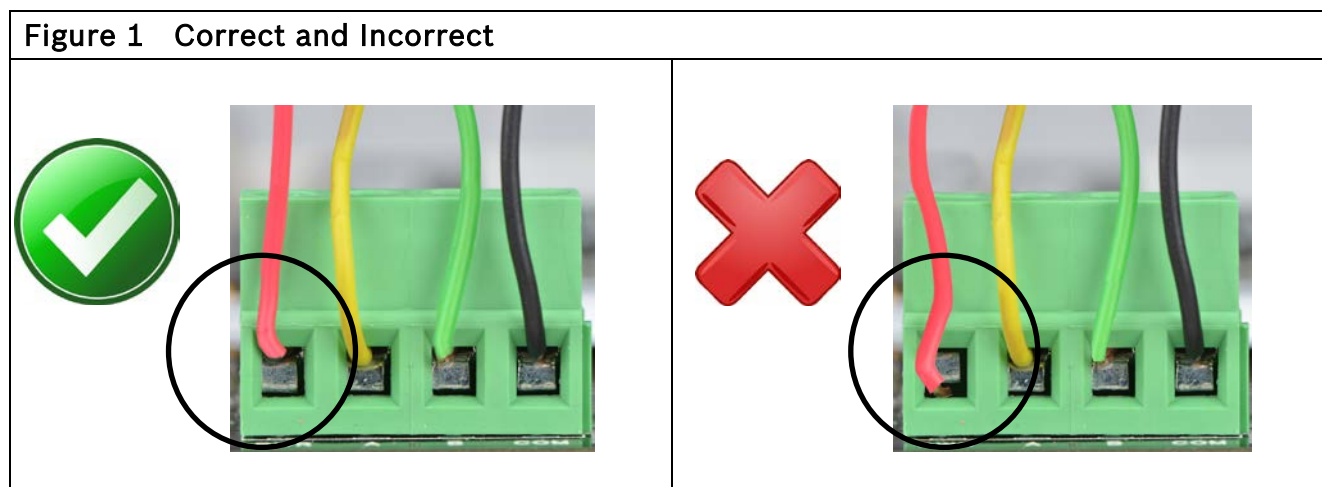

If a failure of the B820 is observed, return the product under warranty. Call (800) 366-2283 or send an e-mail to repair@us.bosch.com to begin the process for Bosch's advanced warranty replacement.

The design of the B820 terminal block is being updated to further reduce the possibility of this wire insertion error.

