



Technical Bulletin

New Generation POPIT Missings

<p>Issue severity</p> <p><input type="checkbox"/> High. Act immediately</p> <p><input type="checkbox"/> Medium. Bosch Security Systems strongly recommends you take the action described below.</p> <p><input checked="" type="checkbox"/> Low. Advisory</p>	<p>Products affected</p> <p>Name/CTN of product</p> <ul style="list-style-type: none"> ▶ D9127T ▶ D9127U ▶ B9512G ▶ B8512G ▶ D8125
---	---

Date

August 22, 2024

Resolution

Bosch will fix this issue in control panel firmware version 3.15.xxx. Expected to release in Q4, 2024.


Issue

When used on the B9512G or B8512G control panels, any changes made to the panel configuration from RPS, keypad, BMS, etc. may result in new generation POPITs that are connected through a B600/D8125 to show as “missing.” If the change is made while the control panel is armed, the device shown as missing may cause an alarm.

Points shown as missing will return on their own within 30 seconds. Depending on programming, they may need to be cleared or acknowledged.

Old POPIT

New POPIT

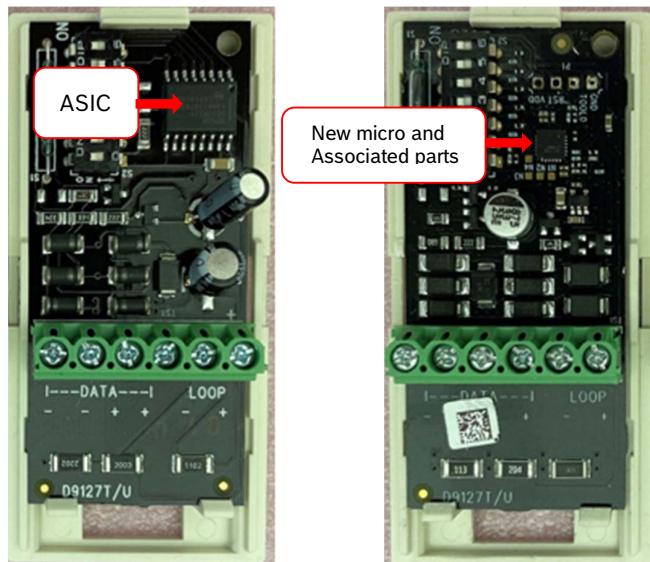

Bosch Security Systems B.V.

Torenallee 49

5617 BA Eindhoven

Netherlands

www.boschsecurity.com

© Bosch Security Systems B.V., 2024